PRINTED: 10/18/2012 DEPARTMENT OF HEALTH AND HUMAN SERVICES FORM APPROVED CENTERS FOR MEDICARE & MEDICAID SERVICES OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING 01 - MAIN BUILDING 01 B. WING 445205 10/15/2012 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 8249 STANDIFER GAP ROAD CONSULATE HEALTH CARE OF CHATTANOOGA CHATTANOOGA, TN 37421 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION ID (X5) (EACH DEFICIENCY MUST BE PRECEDED BY FULL COMPLETION PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE TAG REGULATORY OR USC IDENTIFYING INFORMATION) TAG CROSS-REFERENCED TO THE APPROPRIATE DATE DEFICIENCY) K 038 NFPA 101 LIFE SAFETY CODE STANDARD K 038 SS=D Preparation and/or execution of this plan of Exit access is arranged so that exits are readily correction does not constitute admission or accessible at all times in accordance with section agreement by the provider with the statement 7.1 19.2.1 of deficiencies. The plan of correction is prepared and/or executed because it is required by provision of Federal and State regulations. K-038 This STANDARD is not met as evidenced by: Based on observation, the facility failed to assure 1. No residents suffered harm. exits and exit discharges were accessible. 2. (1) Delayed egress door by boiler room door was repaired and The findings include: operating properly on 10/16/2012. Delayed egress door located on the Observation on October 16, 2012 between the east corridor was repaired and was times of 12 00 p.m. and 1:30 p.m. revealed the operating properly on 10/31/2012 (2)Sidewalk will be installed by 1. Delayed egress doors by boiler room 1 12/1/2012. leading out to smoking area and the back of east 3. The facility's Maintenance Director corridor did not work properly or open upon will conduct QI monitoring to testina. ensure that the facility's delayed Exits from the back of the building did not egress doors are operating properly. have a sidewalk that lead to the public way. OI monitoring will be conducted 5 x weekly for 4 weeks, then 3 x These findings were verified by the Maintenance weekly for 4 weeks, then 1 x Director and acknowledged by the Administrator weekly for 4 weeks, then 1 x during the exit conference on October 16, 2012. monthly for 9 months, 100% of K 054 NFPA 101 LIFE SAFETY CODE STANDARD K 054 doors will be monitored. SS=F The facility's Maintenance Director All required smoke detectors, including those will report results of QI monitoring activating door hold-open devices, are approved, to the Quality maintained, inspected and tested in accordance Assurance/Performance with the manufacturer's specifications. Improvement (QA/PI) Committee monthly x 12 months for continued compliance and/or revision.

Any deficiency statement ending with an asterisk (*) denotes a deficiency which the institution may be excused from correcting providing it is determined that other safeguards provide sufficient protection to the patients. (See instructions.) Except for nursing homes, the findings stated above are disclosable 90 days following the date of survey whether or not a plan of correction is provided. For nursing homes, the above findings and plans of correction are disclosable 14 days following the date these documents are made available to the facility. If deficiencies are cited, an approved plan of correction is requisite to continued program participation.

Event ID: R9ZZ21

program participation.

This STANDARD is not met as evidenced by:

LABORATORY DIRECTOR'S OR PROVIDER SUPPLIER REPRESENTATIVE'S SIGNATURE

FORM CMS-2567(62-99) Previous Versions Obsolete

(X6) DATE 160-31-12

TITLE

Facility ID: TN3314

PRINTED: 10/18/2012 DEPARTMENT OF HEALTH AND HUMAN SERVICES FORM APPROVED CENTERS FOR MEDICARE & MEDICAID SERVICES OMB NO. 0938-0391 STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING 01 - MAIN BUILDING 01 B. WING 445205 10/15/2012 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 8249 STANDIFER GAP ROAD CONSULATE HEALTH CARE OF CHATTANOOGA CHATTANOOGA, TN 37421 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION ID $\{X5\}$ PREFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL **PREFIX** (EACH CORRECTIVE ACTION SHOULD BE COMPLETION TAG REGULATORY OR LSC IDENTIFYING INFORMATION) DATE CROSS-REFERENCED TO THE APPROPRIATE TAG DEFICIENCY) K 054 Continued From page 1 K 054 Based on record review and interview, the facility failed to assure smoke detectors were tested for K-054 sensitivity every two (2) years. No residents suffered harm. The findings include: Smoke detectors were inspected and tested for sensitivity on Record review and interview with the 10/19/2012 by Simplex. 100% Maintenance Director on October 16, 2012 at passed. 11:00 a.m. confirmed that the facility failed to test The facility's Maintenance Director smoke detectors for sensitivity every two (2) will conduct QI monitoring to years. ensure that the facility's smoke detectors are tested for sensitivity This finding was verified by the Maintenance every 2 years in accordance with Director and acknowledged by the Administrator the manufacturer's specifications. during the exit conference on October 16, 2012. OI monitoring will be conducted K 067 NFPA 101 LIFE SAFETY CODE STANDARD K 067 monthly x 3 months, then quarterly SSOF x 9 months. Heating, ventilating, and air conditioning comply The facility's Maintenance Director with the provisions of section 9.2 and are installed will report results of QI monitoring in accordance with the manufacturer's to the Quality specifications 19 5.2.1, 9.2, NFPA 90A, Assurance/Performance 19 5 2.2 Improvement (QA/PI) Committee monthly x 12 months for continued compliance and/or revision. K-067 This STANDARD is not met as evidenced by: Based on observation, interview, and record No residents suffered harm. review, the facility failed to assure the fire Fire dampers will be inspected and dampers were maintained in accordance with tested on by 12/1/2012. NFPA 90A. The facility's Maintenance Director will conduct QI monitoring to The findings include: ensure that the facility's fire

Record review and interview with the

Maintenance Director on October 16, 2012 at

the required 4-year fire damper maintenance.

11:05 a.m. confirmed the facility failed to perform

dampers are maintained in

accordance with NFPA 90A to

include required 4 year fire damper

maintenance. QI monitoring will

DEPARTMENT OF HEALTH AND HUMAN SERVICES CENTERS FOR MEDICARE & MEDICAID SERVICES

FORM APPROVED OMB NO. 0938-0391

STATEMENT OF DEFICIENCIES AND PLAN OF CORRECTION		(X1) PROVIDER/SUPPLIER/CLIA IDENTIFICATION NUMBER:	(X2) MULTIPLE CONSTRUCTION A. BUILDING 01 - MAIN BUILDING 01 B. WING		(X3) DATE SURVEY COMPLETED			
· · · · · ·		445205				· · ·	/2012	
NAME OF PROVIDER OR SUPPLIER CONSULATE HEALTH CARE OF CHATTANOOGA				STREET ADDRESS, CITY, STATE, ZIP CODE 8249 STANDIFER GAP ROAD CHATTANOOGA, TN 37421				
(X4) ID PREFIX TAG	SUMMARY STATEMENT OF DEFICIENCIES (EACH DEFICIENCY MUST BE PRECEDED BY FULL REGULATORY OR LSC IDENTIFYING INFORMATION)		ID PREFIX TAG		PROVIDER'S PLAN OF CORRECTION (X5) (EACH CORRECTIVE ACTION SHOULD BE COMPLETION CROSS-REFERENCED TO THE APPROPRIATE DEFICIENCY)			
K 067	This finding was ve Supervisor and ack	REGULATORY OR LSC IDENTIFYING INFORMATION) Continued From page 2 This finding was verified by the Maintenance Supervisor and acknowledged by the administrator during the exit conference on		067	be conducted monthly then quarterly x 9 mon 4. The facility's Maintens will report results of Q to the Quality Assurance/Performanc Improvement (QA/PI) monthly x 12 months for compliance and/or rev	ths. ance Director I monitoring e Committee or continued	3 months, s. ce Director monitoring ommittee	

Event ID: R9ZZ21